


ALIGNMENT PROCEDURE

Operation	Connect Test Oscillator to—	Dummy Antenna	Set Test Osc. Jo	Band	Set Dial At	Adjust Trimmers	Purpose
1	1st Det. Grid	½ Mfd.	456	Br'dc't	600	ABCD	I. F. Algm't.
2	Rec. Ant. Lead	200 Mmfd.	1500	"	1500	F	Set Osc. to Scale
3	" " "	200 Mmfd.	1500	"	1500	G	Algm't of Ant.
4	" " "	200 Mmfd.	600	"	600	J	Rock gang & adj. for max. output
5	" " "	200 Mmfd.	1500	"	1500	FG	Rpt. 3 & 4

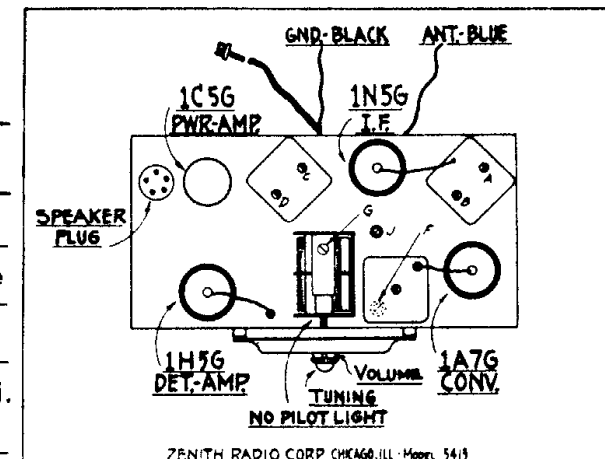

Location of tubes and trimmers