


S	12.3.4.5.6.8.10.35.7.9.11.	14.16.18.	15.17.19	22.23.33.34.	24.25.26.27.	38.39.40.31.						
C	5.14.6.8.	9.10.	13.1.2.3.15.16	17.18.19.20.21	22.23.24.25.26.28.	4.30.31.33.34.35.36.37.38	40.41.42.55.43.	45.46.47.39.48.49.	44.			
R	46	1	36.	2	3.	4.5.6.	7.	8.9.10.11.	12.13.14.15.16.17.	19.20.21.22.35.23.24.25.26.27	34.	33

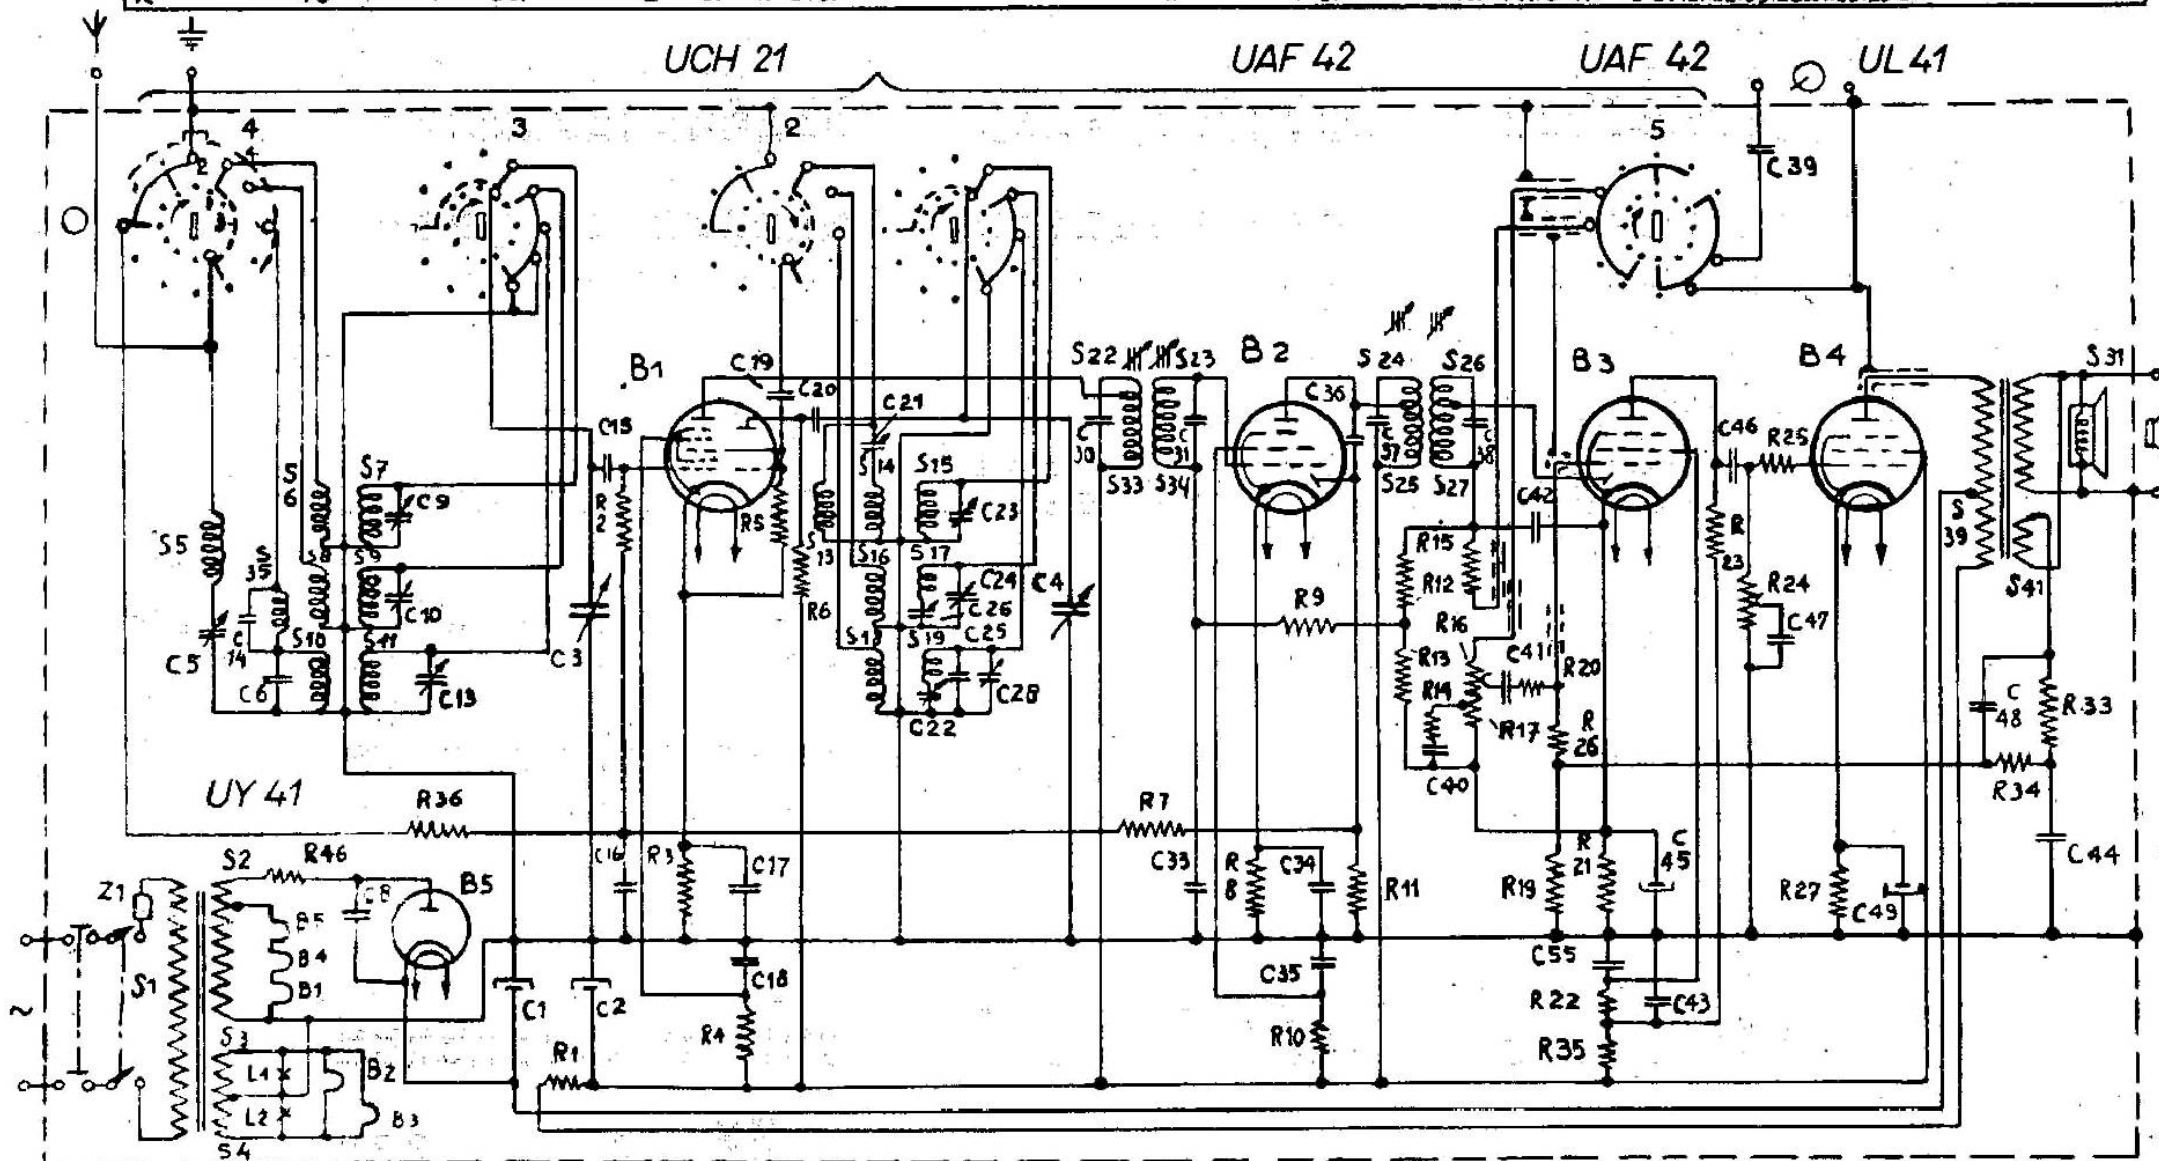

ZF = 452 kHz

SIERA 221 A

# Stückliste zu Modell 221 A

R 1	1200	Ohm	R 12	1,5	Megohm	R 23	0,22	Megohm
R 2	0,82	Megohm	R 13	1,5	Megohm	R 24	0,5	Megohm
R 3	150	Ohm	R 14	15000	Ohm	R 25	1000	Ohm
R 4	15000	Ohm	R 15	56000	Ohm	R 26	1,5	Megohm
R 5	47000	Ohm	R 16	0,275	Megohm	R 27	150	Ohm
R 6	22000	Ohm	R 17	0,075	Megohm	R 33	12000	Ohm
R 7	1	Megohm	R 19	3300	Ohm	R 34	10000	Ohm
R 8	470	Ohm	R 20	0,47	Megohm	R 35	0,12	Megohm
R 9	0,68	Megohm	R 21	3300	Ohm	R 36	1,2	Megohm
R 10	47000	Ohm	R 22	0,82	Megohm	R 46	120	Ohm
R 11	1	Megohm						

S 1	45	Ohm	S 13	1	Ohm	C 31	115	pf
S 2	45	Ohm	S 14	1	Ohm	S 24	4,2	Ohm
S 3	1	Ohm	S 15	1	Ohm	S 25	4,6	Ohm
S 4	1	Ohm	S 35	45	Ohm	S 26	2,8	Ohm
Z 1	-		S 16	3	Ohm	S 27	4,6	Ohm
S 5	30	Ohm	S 17	7	Ohm	C 37	115	pf
C 5	25	pf	S 18	6	Ohm	C 38	115	pf
S 6	1	Ohm	S 19	15	Ohm	S 38	300	Ohm
S 7	1	Ohm	S 22	4,2	Ohm	S 39	24	Ohm
S 8	100	Ohm	S 23	2,8	Ohm	S 40	1	Ohm
S 9	6	Ohm	S 33	4,6	Ohm	S 41	10	Ohm
S 10	100	Ohm	S 34	4,6	Ohm	S 31	4	Ohm
S 11	1	Ohm	C 30	115	pf			

C 1	50	uf	C 19	47	pf	C 37	115	pf
C 2	50	uf	C 20	220	pf	C 38	115	pf
C 3	12-492	pf	C 21	125	pf	C 39	10000	pf
C 4	12-492	pf	C 22	200	pf	C 40	27000	pf
C 5	25	pf	C 23	30	pf	C 41	22000	pf
C 6	39	pf	C 24	30	pf	C 42	45	pf
C 8	22000	pf	C 25	33	pf	C 43	0,47	uf
C 9	30	pf	C 26	350-575	pf	C 44	12000	pf
C 10	30	pf	C 28	30	pf	C 45	50	uf
C 13	30	pf	C 30	115	pf	C 46	22000	pf
C 14	18	pf	C 31	115	pf	C 47	3900	pf
C 15	100	pf	C 33	47000	pf	C 48	1500	pf
C 16	47000	pf	C 34	47000	pf	C 49	50	uf
C 17	47000	pf	C 35	47000	pf	C 55	0,1	uf
C 18	47000	pf	C 36	22	pf			

SIERA