


## MARCONI - 501

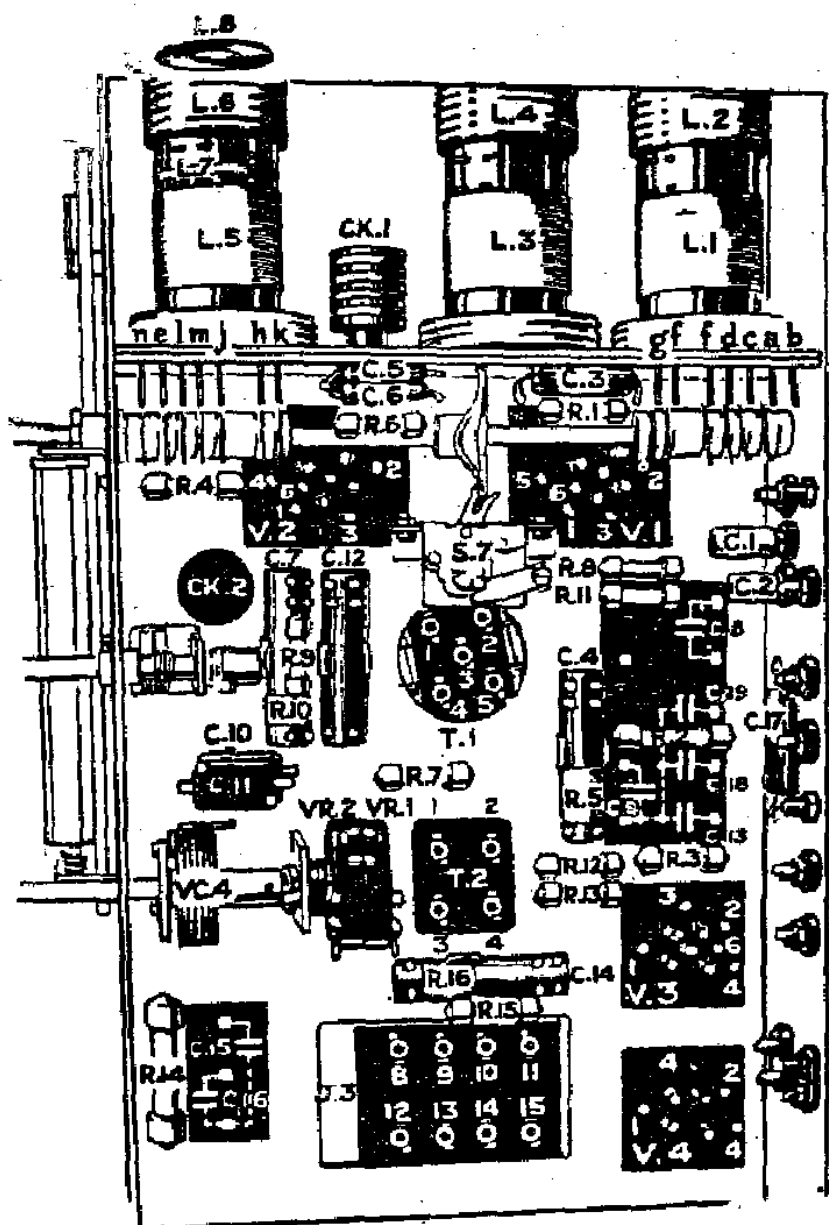

### RADIO UNIT, complete

Securing screw  
Strap  
Shakeproof washer

### Electrical Components of Unit.

Ref. No.	Description.
L1 and L2.	M.W. and L.W. tuning coil on base
L3 and L4.	M.W. and L.W. tuning coil on base
L5 and L6.	M.W. and L.W. tuning and reaction coils
L7 and L8.	M.W. and L.W. tuning and reaction coils
C1.	Tabular
C2.	Fixed condenser .0001 mfd.
C3.	Fixed condenser .0001 mfd.
C4 and R5.	Decoupler unit.
C5.	Fixed condenser .0001 mfd.
C6.	Fixed condenser .0001 mfd.
C7 and R10.	Decoupler unit.
C8.	Fixed condenser .0001 mfd.
C9.	Fixed condenser .0001 mfd.
C10.	Fixed condenser .0001 mfd.
C11.	Fixed condenser .0001 mfd.
C12.	In reloaded tube. Fixed condenser .0001 mfd.
C14 and R16.	Decoupler unit.
C15.	Fixed condenser .0001 mfd.
C16.	Fixed condenser .0001 mfd.
C17.	Fixed condenser .0001 mfd.
VC1.	2-gang variable condenser
VC2.	2-gang variable condenser
VC3.	2-gang variable condenser
R1.	Resistance 2,000 ohm
R2.	Resistance 50,000 ohm
R3.	Resistance 10,000 ohm
R4.	Resistance 2,000 ohm
R5 and C4.	Decoupler unit. Resistance 600 ohm + .1 mfd.
R6.	Resistance .5 megohm
R7.	Resistance 200,000 ohm
R8.	Resistance 35,000 ohm
R9.	Resistance 1 megohm
R10 and C7.	Decoupler unit.
R11.	Resistance 10,000 ohm
R12.	Resistance 5,000 ohm
R13.	Resistance 10,000 ohm
R14.	Resistance 1,000 ohm
R15.	Resistance 10,000 ohm