


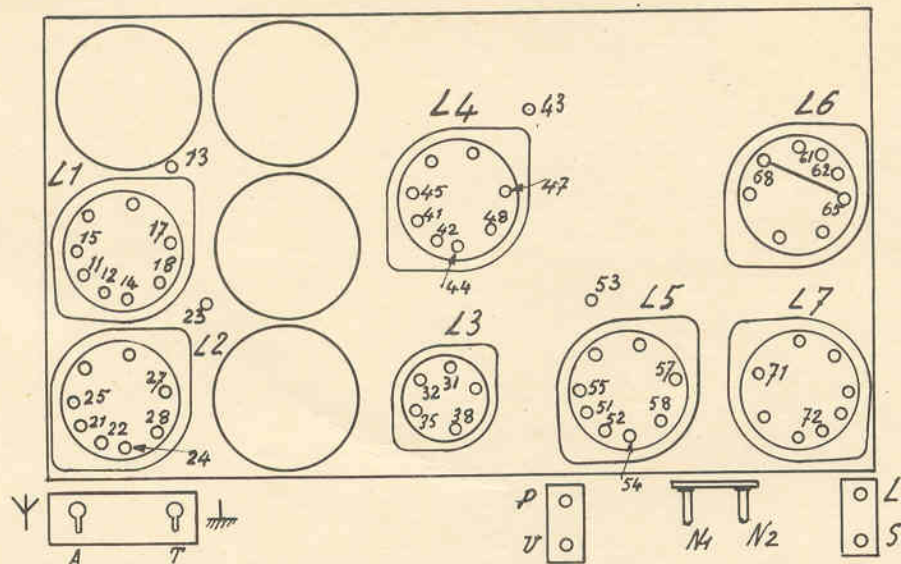

Circuits des Résistances

9	13	23	38	43	48	53													
	65	100	165	140	300	180													
10	17	18	45	47	65														
	440	460	410	340	200														
11	25	15	58	57	27	28													
	360	360	330	380	440	445													
12	35	32x11	12x22	21x41	42x51	52x61	68	62	N1	N2									
	10	10	10	10	10	10	260	350	185										

Circuits des Capacités

9	27	55	65	68	45	18													
	120	450	465	480	465	105													
10	17	47																	
	325	125																	
11	P	L	S	11															
	260	390	380	250															
12	43	A	T	48x53	45x48	V													
	190	190	210	175	270	270													

Placer le commutateur de A sur G.O.

" le volume contrôle au maximum

" le condensateur variable au maximum

Pour la mesure de V placer le commutateur de A sur P.V

Les mesures sont faites par rapport au châssis