


Sears, Roebuck & Co. Chassis 528.40500, Catalog Nos. 6056A and 6057A

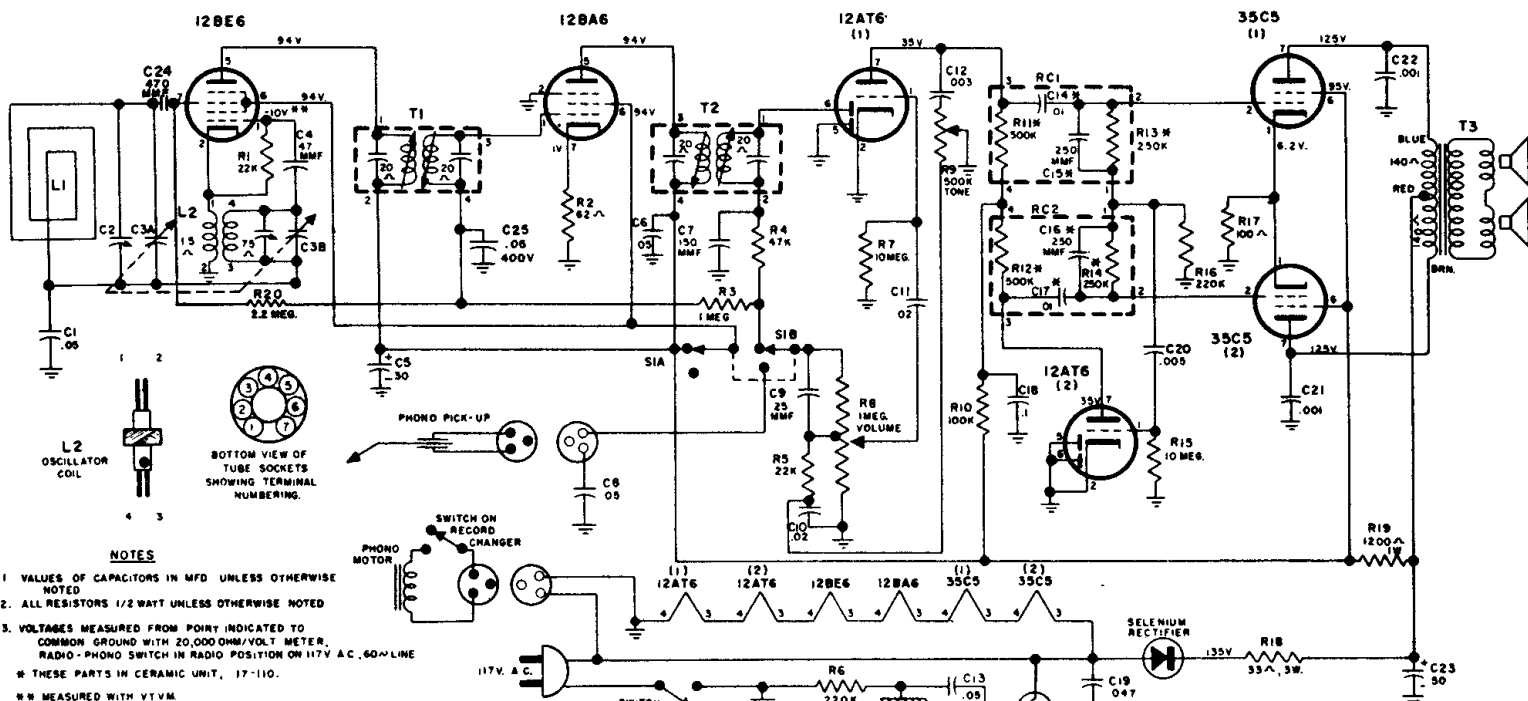

ALIGNMENT PROCEDURE

POSITION OF TUNER	GENERATOR FREQUENCY	DUMMY ANTENNA	GENERATOR CONNECTION	TRIMMER ADJUSTMENT	TRIMMER FUNCTION
open	455 KC	.1 mfd.	pin 7 12BE6	T1 and T2 top and bottom	I.F.
open	1630 KC	.1 mfd.	pin 7 12BE6	C3B	Oscillator
1400 KC	1400 KC	HAZELTINE TEST LOOP	C2*		Antenna

* Located on Antenna.

