


SEARS, ROEBUCK and CO.

SEARS, ROEBUCK & CO. Chassis 528.54880, Models 4079, 4080, 4081, 4082

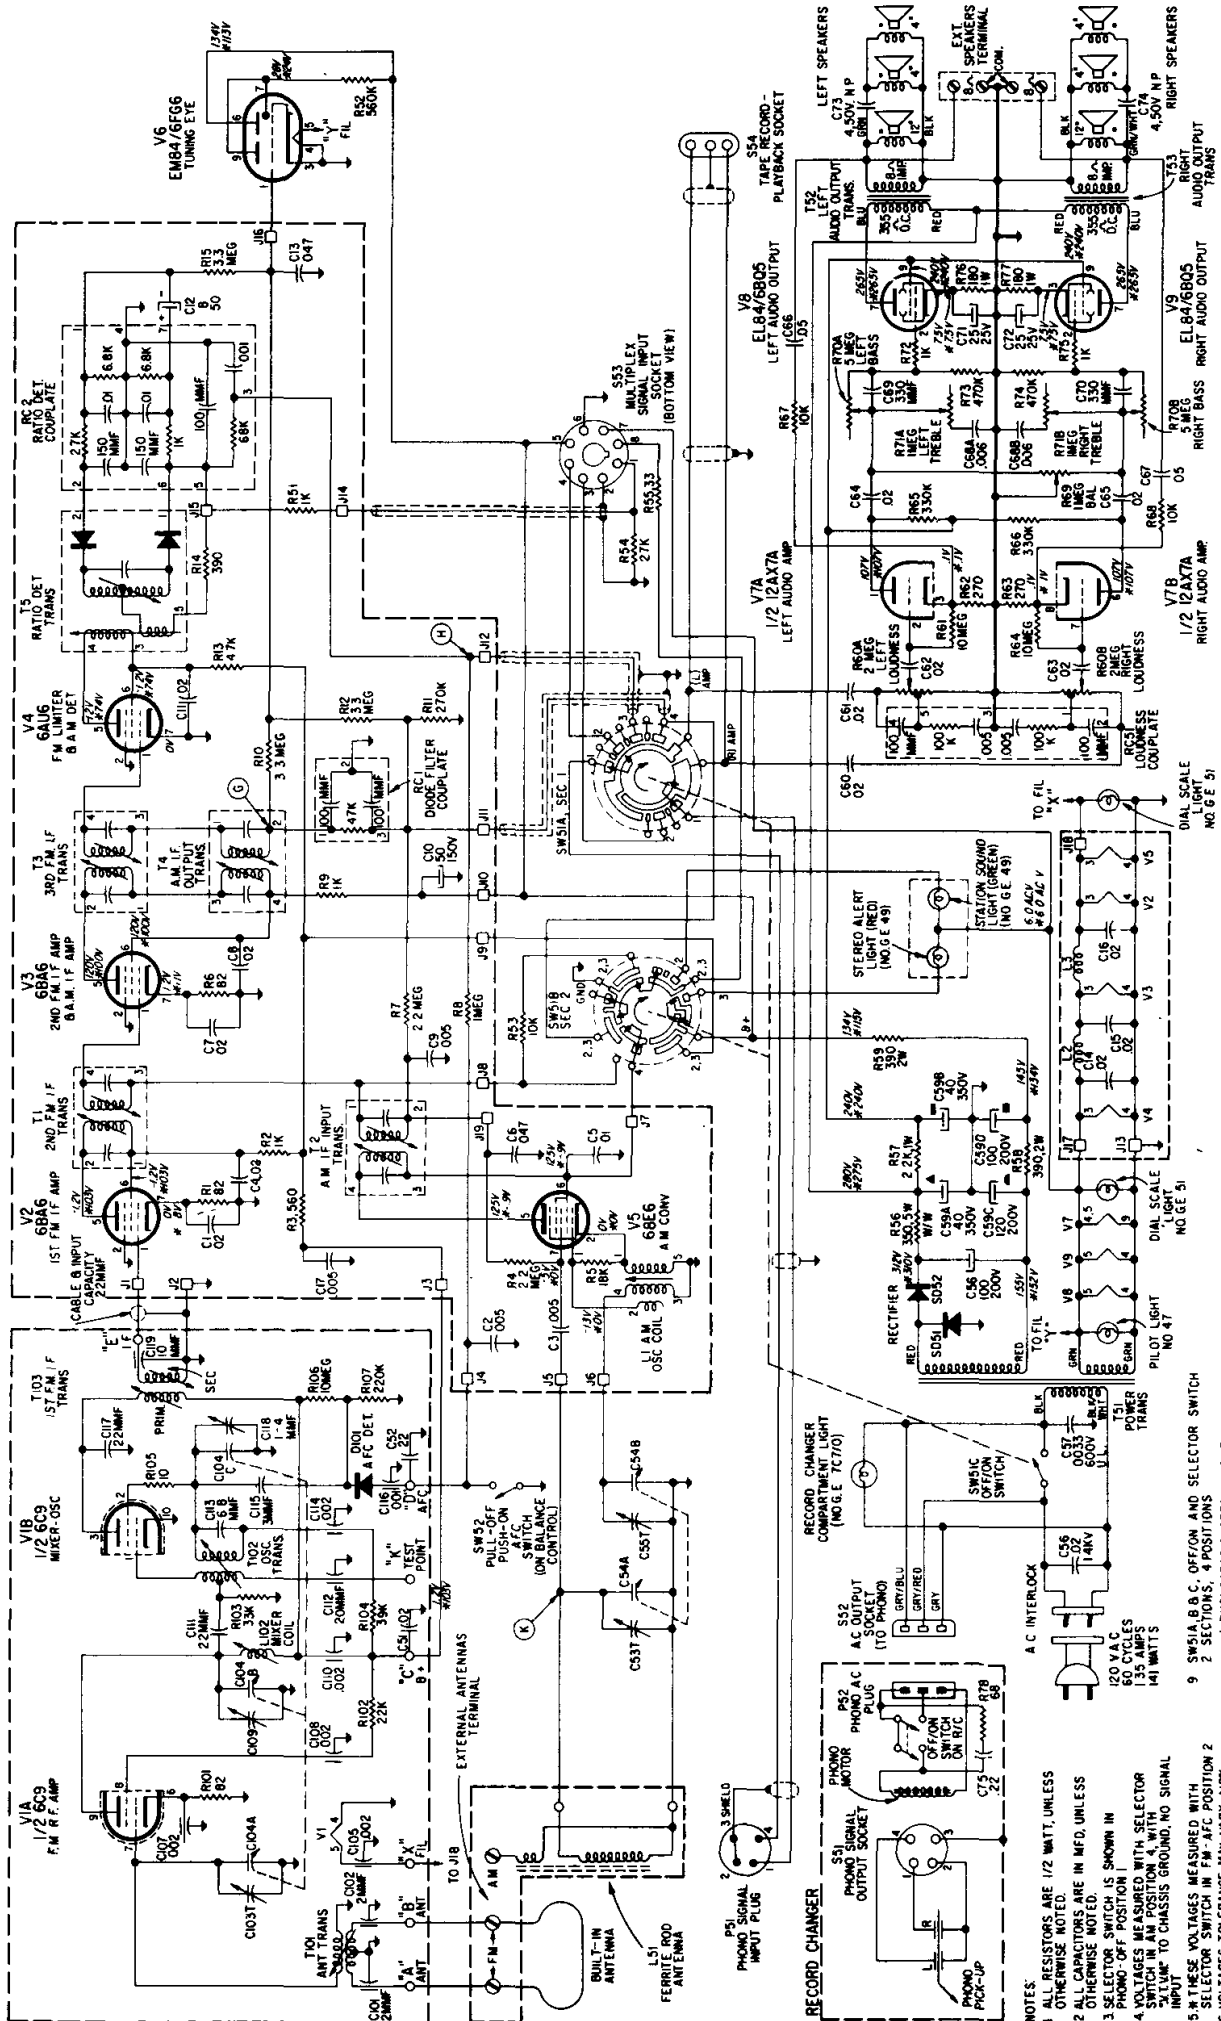

A.M. I.F. 455 KC.
F.M. I.F. 10.7 MC.

SEARS, ROEBUCK & CO. Chassis 528.54880, Models 4079, 4080, 4081, 4082

- NOTES:
1. ALL RESISTORS ARE 1/2 WATT, UNLESS OTHERWISE NOTED.
 2. ALL CAPACITORS ARE IN MFD, UNLESS OTHERWISE NOTED.
 3. SELECTOR SWITCH IS SHOWN IN PHONO-OFF POSITION.
 4. VOLTAGES MEASURED WITH SELECTOR SWITCH IN PHONO-OFF POSITION, NO SIGNAL INPUT.
 5. * THESE VOLTAGES MEASURED WITH SELECTOR SWITCH IN FM-AFC POSITION.
 6. VOLTAGE TOLERANCE MAY VARY 20%.
 7. J1, J2 ETC ARE TERMINAL CONNECTION ON CIRCUIT BOARD.
 8. DOTS ON SPEAKERS INDICATE...